STRUCTIONAL TRANSPORTIONALOS TINOS 600 E. Valencia Dr.

## RECORD OF INSPECTIONS

## CONTINUATION SHEET

- Excellent

0 - None

- Good

R - Reinspect

- Fair - Bad

\* - Eng. Co.

DATE	WIRING	STOCK & STORAGE	TRASH & DISPOSAL	HEAT & EQPT.	FIRE PTCN. EQUIPMENT	INSPECTOR
9-24-76*						3R
5/4/78	В	R	B	C	В	ELH
	<u> </u>	, ·		320		
() (=0						

/4/78 Fire inspection conducted w/ Don Wall, maintenance foreman INSIDE BUILDING

HOUSEKEEPING - In GOOD order, in general.

FLAMMABLE FINISHING (spray booths) - Two: 1 on S wall; 1 on N wall (third booth has been removed. Permit No. SB 78-54 issued 5/29/78 for use of the booths.

Ventilation - Interconnecting solenoid NOT installed between exhaust fan and paint air supply line on either booth.

Flammable Liquids (paints & thinners) used in this spray application area stored in open containers (10 galions total, booth No. 1 (S wall). Exhaust Filters - Some out of place; missing.

Booth No. 2 - NOT secured to floor; has caused duct to twist.

MACHINE SHOP AREA - NO magnesium being machined at this time; however, a Class D fire extinguishing powder is provided from the past operation. FIRE EXTINGUISHERS - In general: service dated 1977; extinguishers setting on floor throughout the plant.

## OUTSIDE OF PLANT

FLAMMABLE LIQUIDS - No change in quantity, as listed 10/17/75.

55 gallon drums lying on their Storage Area side; being dispensed by gravity. Grounding device NOT provided for drums.

Approximately fifteennempty 55 gallon drums have been stored in the area, outside of chain link-fenced compound.

"NO SMOKING" signs not clearly readable in this flammable liquid storage area.

Housekeeping in POOR condition in storage area.

LPG tank (435 gallons, aboveground) - SECURED to concrete pad, as recommended 10/17/75.

Reinspection pending.

ELH

18/74 inspection - contimied:

BOOTH - Flammable uid use & storage (thinn paint) - One day's #1 supply stored in 5 gallon safety container; 15 gal drum of thinner REMOVED (now stored in outside flammable liquid storage compound.

Three 5 gal buckets of washing thinner REMOVED; replaced w/ fuse-equipped, covered wash trays (5 gal volume).

Miscellaneous paint storage REMOVED from area; stored outside.

BOOTH - NE section of building - 4'x4½' open-front type: No change in #2 installation, except:

Booth electrical & paint air supply lines DISCONNECTED; a posted sign, "Do not use" attached until booth is relocated & installed in compliance w/ UFC, Article 14.

OUTSIDE OF BUILDING

FLAMMABLE LIQUID STORAGE AREA:

HOUSEKEEPING in FAIR order at this time; empty barrels are being sent back to supplier.

GASOLINE - One 55 gal drum used as fuel for towmotor, per permit #FL70-79 GROUNDING - Barrel pump OROVIDED for dispensing; grounding device NOT provided for use during dispensing of gasoline.

GROUNDING - General storage & dispensing. Metal drum rack type storage provided w/ grounding facilities; however, grounding cable is BROKEN loose from metal ground rod.

Richard Beaver advised of existing conditions of this fire inspection. <u>ELH</u> /17/75 Met w/ Richard Beaver, assistant to president:

INSIDE BUILDING

HOUSEKEEPING - In GOOD order in general.

FLAMMABLE LIQUIDS - Three 5 containers of isopropyl alcohol & red-labeled varnish used in pregnation dept; safety containers NOT used for storage FLAMMABLE FINISHING BOOTH #2 (NE section of building); 4'x4' open front:

Booth remains INOPERATIVE (disconnected), as in 1/18/74 inspection.

ADDITION of BOOTH #3, Pregnation dept area - Substandard booth (4'x3', open front, open back, partially of wood construction):

No sprinkler system, filters, or interconnecting switch between painting air supply/exhaust fan. Booth is used w/ small "air brush" type spraying guns.

Accumulation of paint overspray exists inside this unit, particularly in the immediate area of the spray application.

SPRINKLER SYSTEM - Office area of inspection dept) - SE corner, inside building; approx 10'x30': System has NOT been extended to this area.

MAGNESIUM MACHINING - NONE at this time.

FIRE EXTINGUISHERS - Service dated 11/74.

OUTSIDE OF BUILDING

FLAMMABLE LIQUID STORAGE - 55 gal drums,

HOUSEKEEPING - In FAIR order at this time.

GROUNDING DEVICE - IS PROVIDED, BUT NOT BEING USED.

DISPENSING by gravity; drums are lying on a rack on side of the drums.

QUANTITY: 200 THINNER - Ten 55 gal drums; MEK - Five 55 gal drums;

ISOPROPYL ALCOHOL - Ten 55 gal drums; SOLVENT - Five 55 gal drums; KEROSENE - Five 55 gal drums.

Gasoline is NOT being stored for towmotor use.

LPG (aboveground) - 435 gallons, adjacent to SW fenceline: No permit on file; tank setting on loose concrete footing slabs, resting on top of asphalt; tank NOT secured to footing. Tank is on lease basis from PARGAS, 535 S. Magnolia, Placent (993-9400). Bill Westlund advised.

FIRE BRIGADE - NOT up to date.

Richard Beaver advised of existing conditions of this inspection. ELH